


Repair Parts Sheet	Revision	Revision Date	Product Code Beginning
L3022	Rev. F	10/22	RC756: A RC7513: B B1721K

Fig. 1, Cylinder Assembly

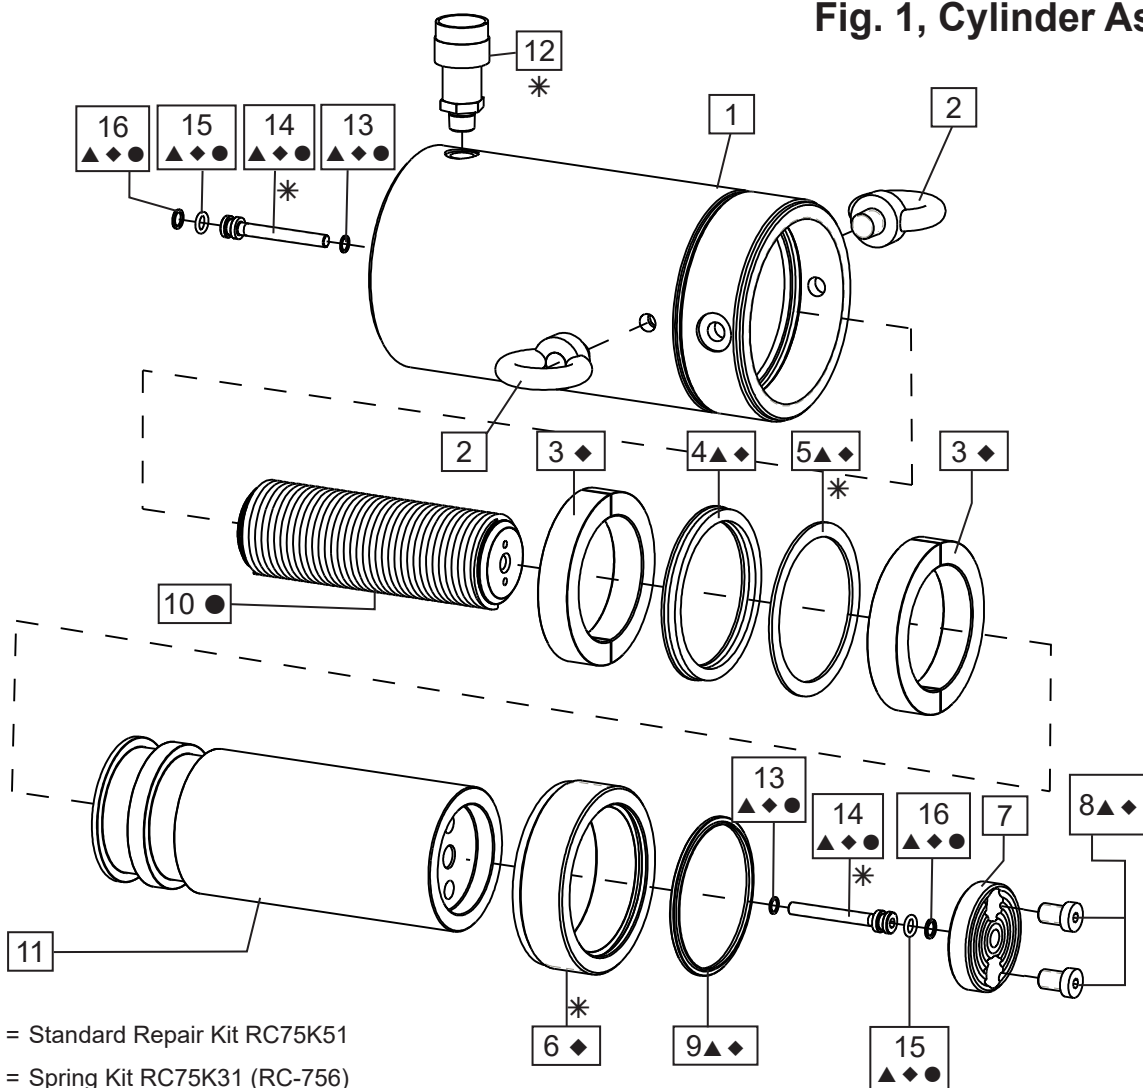

▲ = Standard Repair Kit RC75K51

● = Spring Kit RC75K31 (RC-756)
RC75K32 (RC-7513)

◆ = Premium Repair Kit RC75K71

* = See Notes section for additional information.



**Note: See Page 2
for parts list.**

(*) Notes

Item	Torque / notes
5	Washer to be placed with the sharp edge towards U-Cup.
6	Secure with Loctite 222.
12	Use Loctite 545 or Teflon tape.
12	54 - 81 Nm, 40 - 60 ft - Lbs
14	20 - 24 Nm, 90 - 110 in - Lbs

Repair Parts List, Figure 1

L3022

Item	Description	Qty.	Part Number	
			RC-756	RC-7513
1	Base	1	(Not available)	(Not available)
2	Eye Bolt	2	BSS6350D	BSS6350D
3	Bearing ◆	2	Y489107	Y489107
4	U-Cup ▲ ◆	1	Y577041	Y577041
5	Washer ▲ ◆	1	Y578108	Y578108
6	Stop Ring ◆	1	Y491044	Y491044
7	Saddle, Grooved (incl. #8)	1	L345045SR	L345045SR
8	Cap Screw ▲ ◆	2	L661028	L661028
9	Wiper Ring ▲ ◆	1	F516044	F516044
10	Spring ●	1	DD2343110	DD2340110
11	Plunger	1	(Not available)	(Not available)
12	Coupler	1	CR-400	CR-400
13	Gasket ▲ ◆ ●	2	C846037	C846037
14	Spring Retainer ▲ ◆ ●	2	DC5469160	DC5469160
15	O-Ring ▲ ◆ ●	2	B1110903	B1110903
16	Back-up ▲ ◆ ●	2	B1110564	B1110564
N/S	Dust Cap ▲ ◆	1	DD1782020	DD1782020
N/S	Thread Protector ▲ ◆	1	DD1779271	DD1779271
N/S	O-Ring Coupler ▲ ◆	1	B1116803	B1116803
N/S	Enerpac Decal ▲ ◆	1	DD2217026	DD2217026
N/S	Warning Decal ▲ ◆	1	DA5117026	DA5117026
▲	Repair Kit, Standard	-	RC75K51	RC75K51
◆	Repair Kit, Premium	-	RC75K71	RC75K71
●	Spring Kit	-	RC75K31	RC75K32

Notes:

Premium repair kit includes all standard (▲) repair kit items plus additional premium (◆) items.

N/S = Item not shown.

IMPORTANT: Shaded items are available only in kits (not sold separately).